

SITE NUMBER: CW-L3-02
LOCAL NAME: Unnamed LB #2
WRIA:

NORTH COAST OFF CHANNEL SITE INVENTORY DATA

RIVER SYSTEM: Clearwater **DATE:** 5/5/88 **OBSERVER:** Nettnin

CHANNEL TYPE: Terrace tributary (wall based)

TRIBUTARY TO: Clearwater River (21.0024)

SITE LOCATION: River mile - 6.7 L.B. (Stream catalog)

LEGAL DESCRIPTION:

UPPER END LOWER END

DISSOLVED OXYGEN: Not taken on this date.

WATER TEMP.: 48 F 49 F

AIR TEMP.: 51 F 51 F

FLOW (CFS): 0.25 - 0.5 0.5 - 1.0

SUBSTRATE TYPE: Mostly silt. Some patches of clean gravel.

SITE SIZE: Length- Approximately 400 m
 Width- 3 - 4 ft (Beaver ponds 10 - 20 ft)
 Depth- 3 - 4 inches (Beaver ponds 1 - 2 ft)

WATER SOURCE: Springs

DIRECTIONS TO SITE: Head north on Highway 101. Turn right 0.9 miles beyond mile post 146 onto the Clearwater Rd. Proceed north about 5.3 miles until crossing Wildcat Creek. Then see site direction map.

FISH ACCESS AND CURRENT USE: A small (4 ft) cascade exists at the mouth of this channel but fish should have good access on moderately high river flows. A number of beaver dams limits access to the upper reaches. No fish were seen in the channel at the time of this survey.

FLOODING POTENTIAL: Low.

LANDOWNER: Unknown at this time.

COMMENTS & RECOMMENDATIONS: This spring-fed, terrace trib is situated on a small bench at the base of a steep, 60 - 80 ft terrace wall. Consisting of a series of small beaver ponds, this trib has the appearance of a "natural" beaded channel. A small cascade at the mouth may restrict fish access. Pre-smolts should have little trouble with this barrier during moderate to high river flows, however. If fish can enter this trib, they should do well. There appears to be enough water here to maintain the ponds during short, winter dry spells. Modification of the cascades, deepening and widening of the existing ponds, and installation of control logs would enhance the existing habitat and insure fish access. Machine access to this site would be difficult.

NORTH COAST OFF CHANNEL SURVEY
SUBSEQUENT SITE EVALUATION FORM

River System: Clearwater River

Channel No.: CW-L3-02

Site Name: Unnamed

WRIA:

DATE: 10/26/88

OBSERVER: Nettnin

Water flow is low. Walked trib and did not observe any fry. I kicked a small hole in old beaver dam under large log near the mouth.

127m above beaver flats there is a 20 foot falls, there is a small amount of habitat in this reach


DATE: 11/30/88


OBSERVER: Nettnin/Young

Sites were electroshocked in the middle to upper reaches of this channel (see map). Results are listed below:

Area (Sec.)	Effort	Results
1.) Two small beaver ponds just downstream from the foot of the trail.	147	No fish were caught.
2.) The 3rd pond downstream from the foot of the trail.	76	Caught 3 coho and rolled 2 other salmonids

Clearwater River Site: Qw-23
Channel Cw-23-02

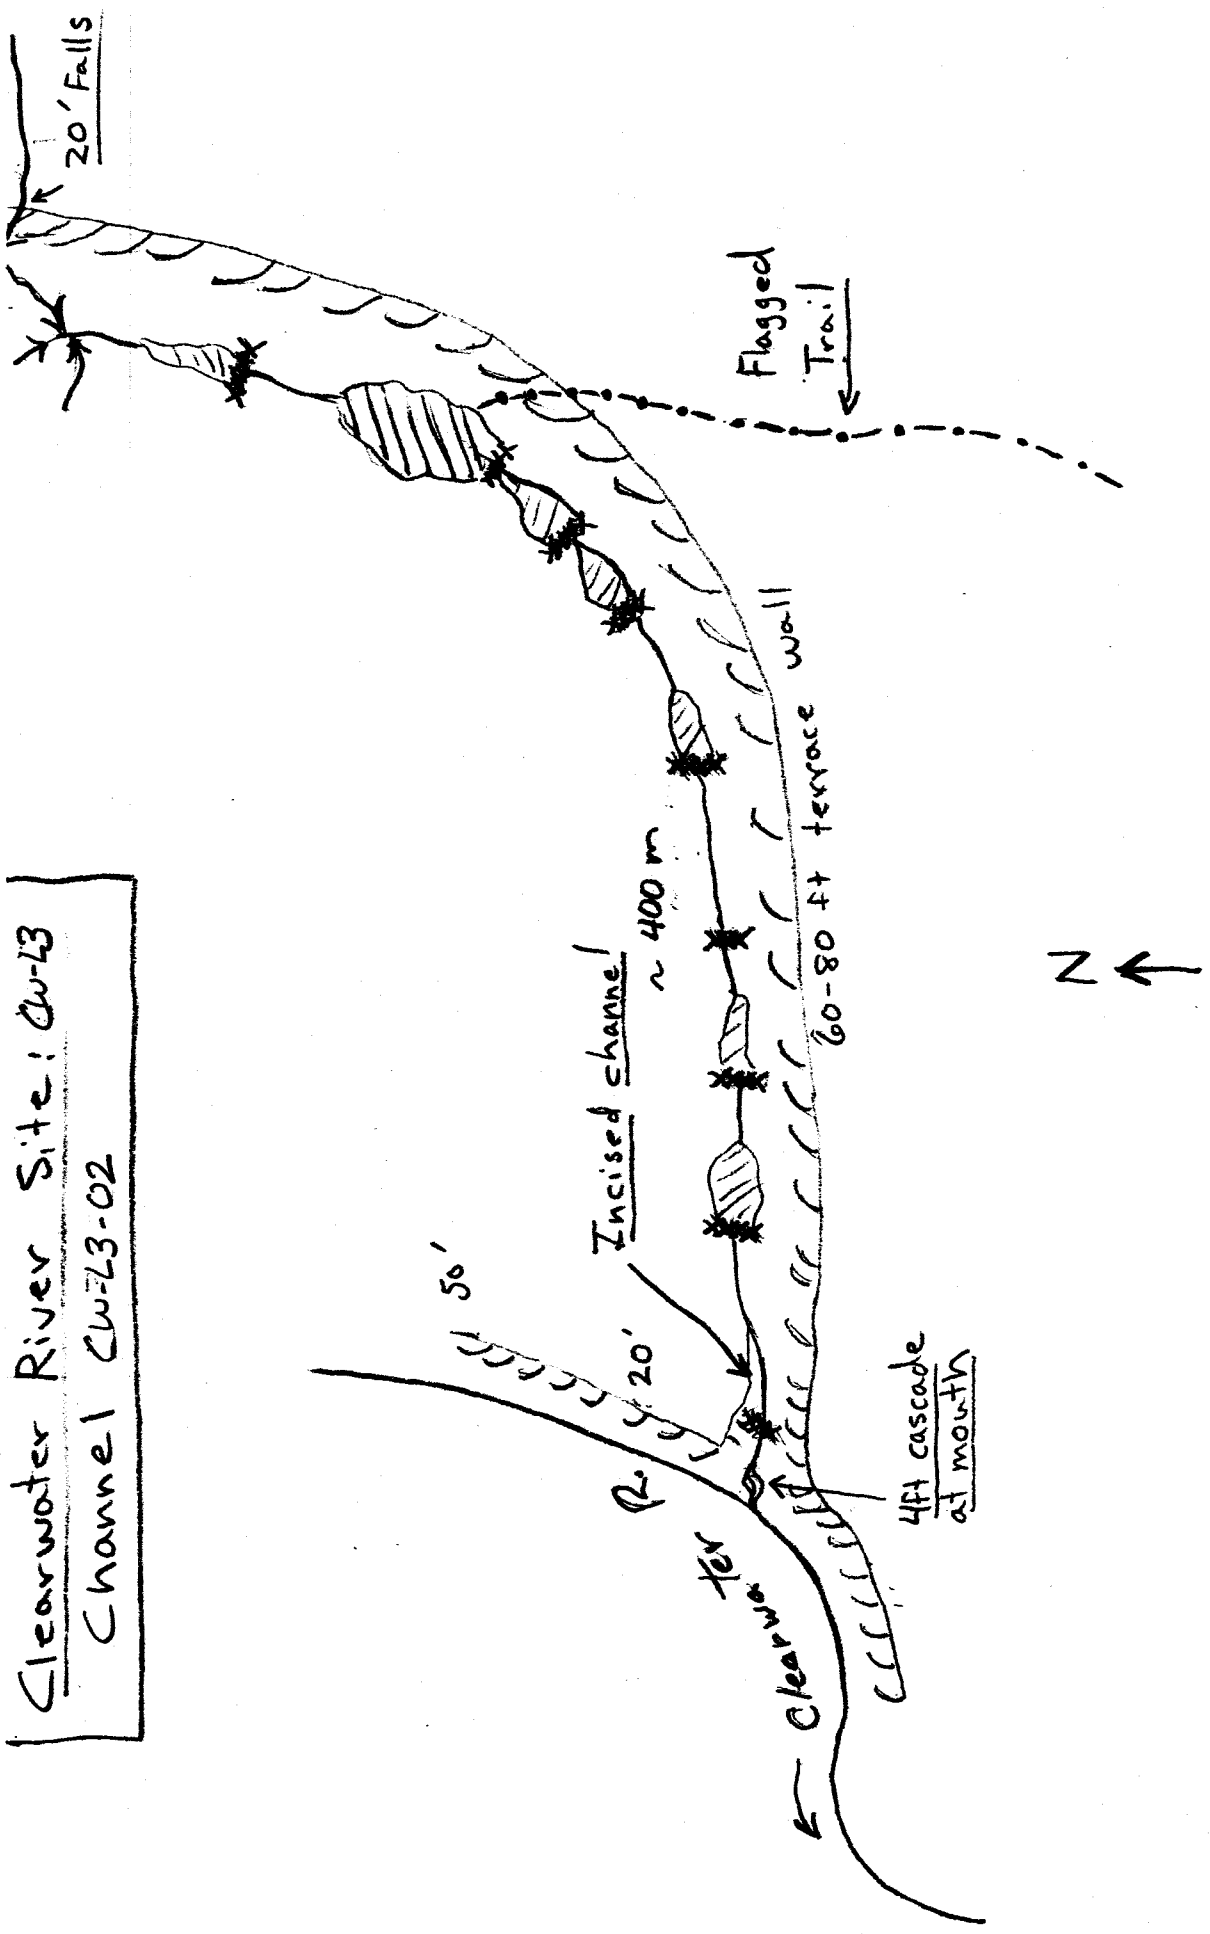

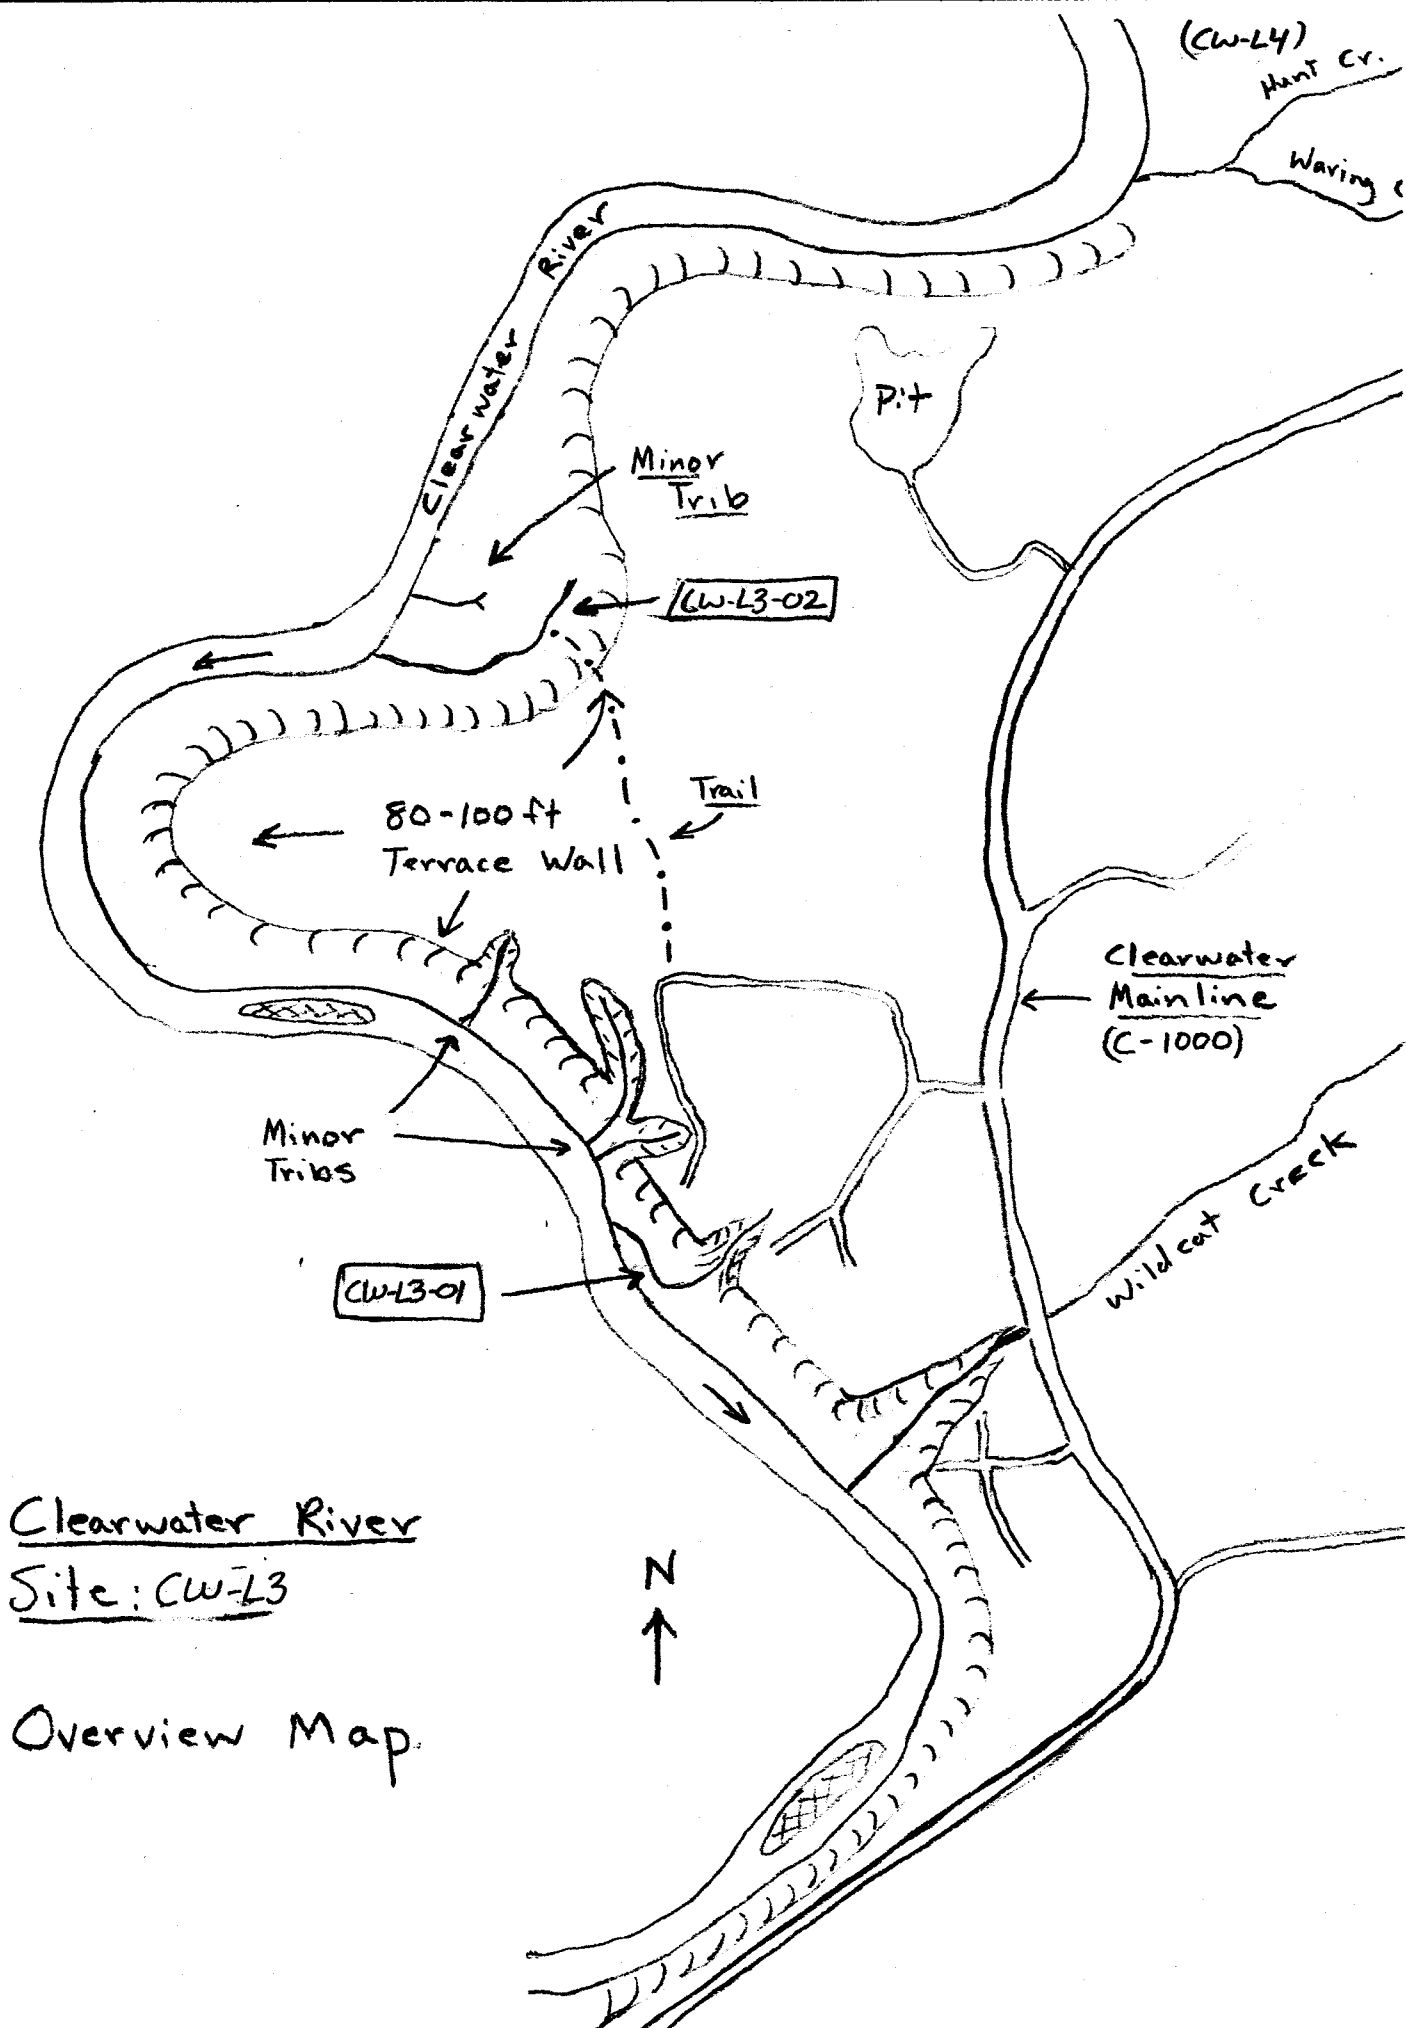

Clearwater River
Site: CW-L3

Overview Map.

